

Date: Wednesday, 19/11/2008 8:35:55 AM
 User: Julie Dawson

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 206L AFT X-TUBE
Job Number	: 43532		
Estimate Number	: 13222		
P.O. Number	:	Part Number	: D206667203TRN
This Issue	: 19/11/2008	S.O. No.	:
Print Rev.	: NC	Drawing Number	: D206-667-243 REV B
First Issue	: 11	Project Number	: N/A
Previous Run	: 43531	Drawing Revision	: B
		Material	:
Written By	:	Due Date	: 26/11/2008
Checked & Approved By	: <u>JUD 08.11.19</u>	Qty:	1 Um: Each
Comment	: Est Rev:A 08-03-06 new issue DD verified by:ec Est Rev B 08.04.02 Removed polish EC verified by: DD		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	D6004115	Crosstube Material
-----	----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part number	Description	Batch
1	D6004-115	Crosstube	<u>B34774</u>

Check OD = 2.500"; ID = 1.800"

Q.m 08.11.19

2.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA089

2-Turn first side as per Folio FA089

3-File down transition lines smooth.

Q.m 08.11.19

3.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------



Comment: INSPECT ALL DIM TO DIM SHEET

Q.m 08.11.19

4.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA089

2-File down transition lines smooth.

3-Remove sand and plugs

Q.m 08.11.19

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 19/11/2008 8:35:55 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206L AFT X-TUBE

Job Number: 43532

Part Number: D206667203TRN

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

Q.M 08-11-19

6.0

QC8

SECOND CHECK



ANM 8-11-19



Comment: SECOND CHECK

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



ANM 8-11-19



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DD 8-11-20

9.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock in kanban rack

Location: *X-TUBE CELL*

ANM 8-11-20

10.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/11/21

Job Completion



MF 08-11-20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: 43532
Description: Crosstube Assembly	Part Number: D206-667-243
Inspection Dwg: D206-667-243 Rev: B	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.490	+0.005/-0.000	2.495	/			
	2.018	+0.005/-0.000	2.022	/			
	2.079	+0.005/-0.000	2.084	/			
	2.145	+0.005/-0.000	2.150	/			
	2.209	+0.005/-0.000	2.214	/			
	2.287	+0.005/-0.000	2.292	/			
	2.363	+0.005/-0.000	2.367	/			
	2.433	+0.005/-0.000	2.437	/			
	0.200	+/-0.010	0.200	/			
	0.500 x 30°	+/-0.010	0.500x30°	/			
	R0.063	+/-0.010	R0.063	/			
	R0.500	+/-0.010	R0.500	/			
	4.438	+/-0.030	4.438	/			
SIDE B	104.91	+/-0.020	104.910	/			
	2.490	+0.005/-0.000	2.495	/			
	2.018	+0.005/-0.000	2.022	/			
	2.079	+0.005/-0.000	2.084	/			
	2.145	+0.005/-0.000	2.150	/			
	2.209	+0.005/-0.000	2.214	/			
	2.287	+0.005/-0.000	2.292	/			
	2.363	+0.005/-0.000	2.367	/			
	2.433	+0.005/-0.000	2.437	/			
	0.200	+/-0.010	0.200	/			
	0.500 x 30°	+/-0.010	0.500x30°	/			
	R0.063	+/-0.010	R0.063	/			
	R0.500	+/-0.010	R0.500	/			
	4.438	+/-0.030	4.438	/			

Measured by: am	Audited by: AWM	Prototype Approval:	N/A
Date: 08.11.19	Date: 5-11-19	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	06.09.01	New Issue (P/O D206-667-203)	KJ/JLM	

Item	Qty -243	Part Number	Description
1	X	D206-667-243	CROSSTUBE ASSEMBLY (206L HIGH AFT)
2	1	D6004-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2892-1	SUPPORT
6	4	D3595-063-450	RUBBER CUSHION
7	4	MS21920-22	CLAMP
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299- 947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:


- 1) MATERIAL: MANUFACTURED FROM D6004-115
FINISHED LENGTH = 104.91±0.020
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-243" AND BATCH NUMBER ON
INSIDE OF CUFF USING VIBRATING STYLUS.
- 7) WEIGHT: 21.9 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY,
TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE
TO BENDING IS 6% BASED ON O.D.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2892-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER
QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-22 CLAMPS WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE
D2892-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE
LOCATED ON CROSSTUBE SUPPORTS.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN.-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN
SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-450 WAS D2856-400-773 (ZN D6-2 & A5-2); REMOVED REF. & ADD TOLERANCES (ZN 4-3, C5-3, D3-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	00.11.17
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	RF	DRAWING NO.	REV. C
MFG. APPR.	RF	D206-667-243	SHEET 1 OF 4
APPROVED	RF	TITLE	SCALE
DE APPR.	RF	CROSSTUBE ASS'Y (206L HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


RELEASED
08/11/2006

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO 43531




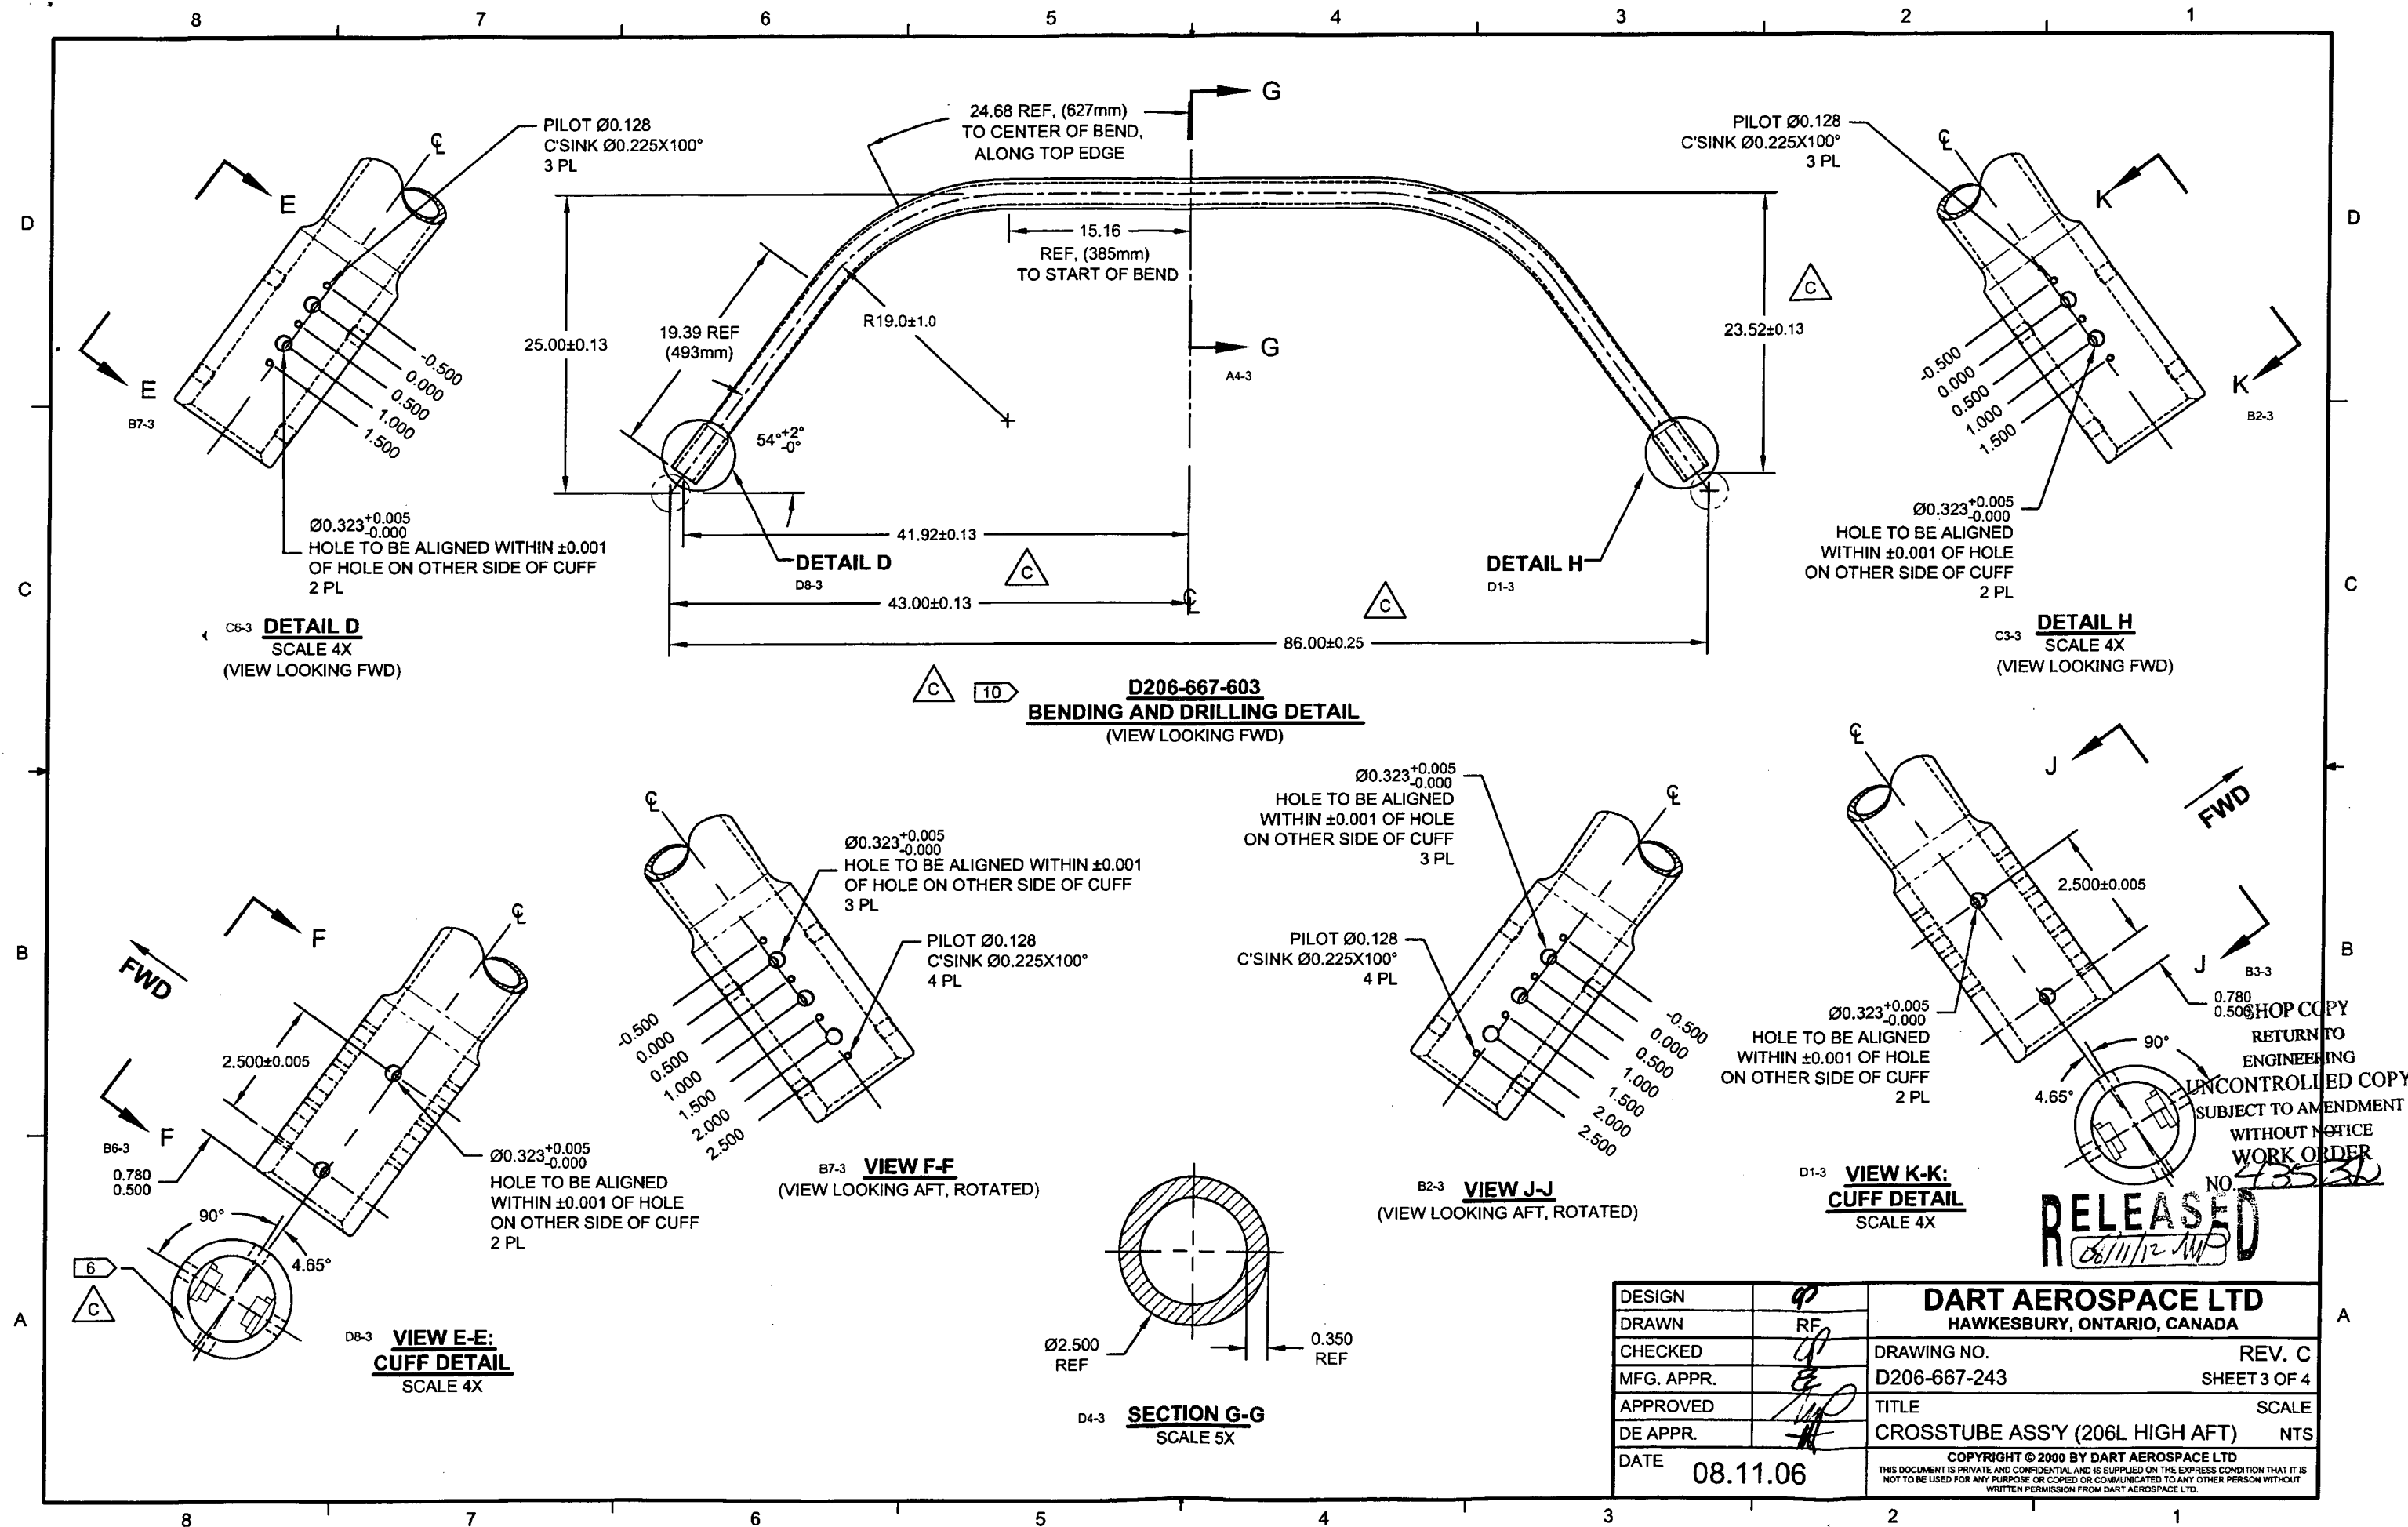


SEE DETAIL L
B7-4

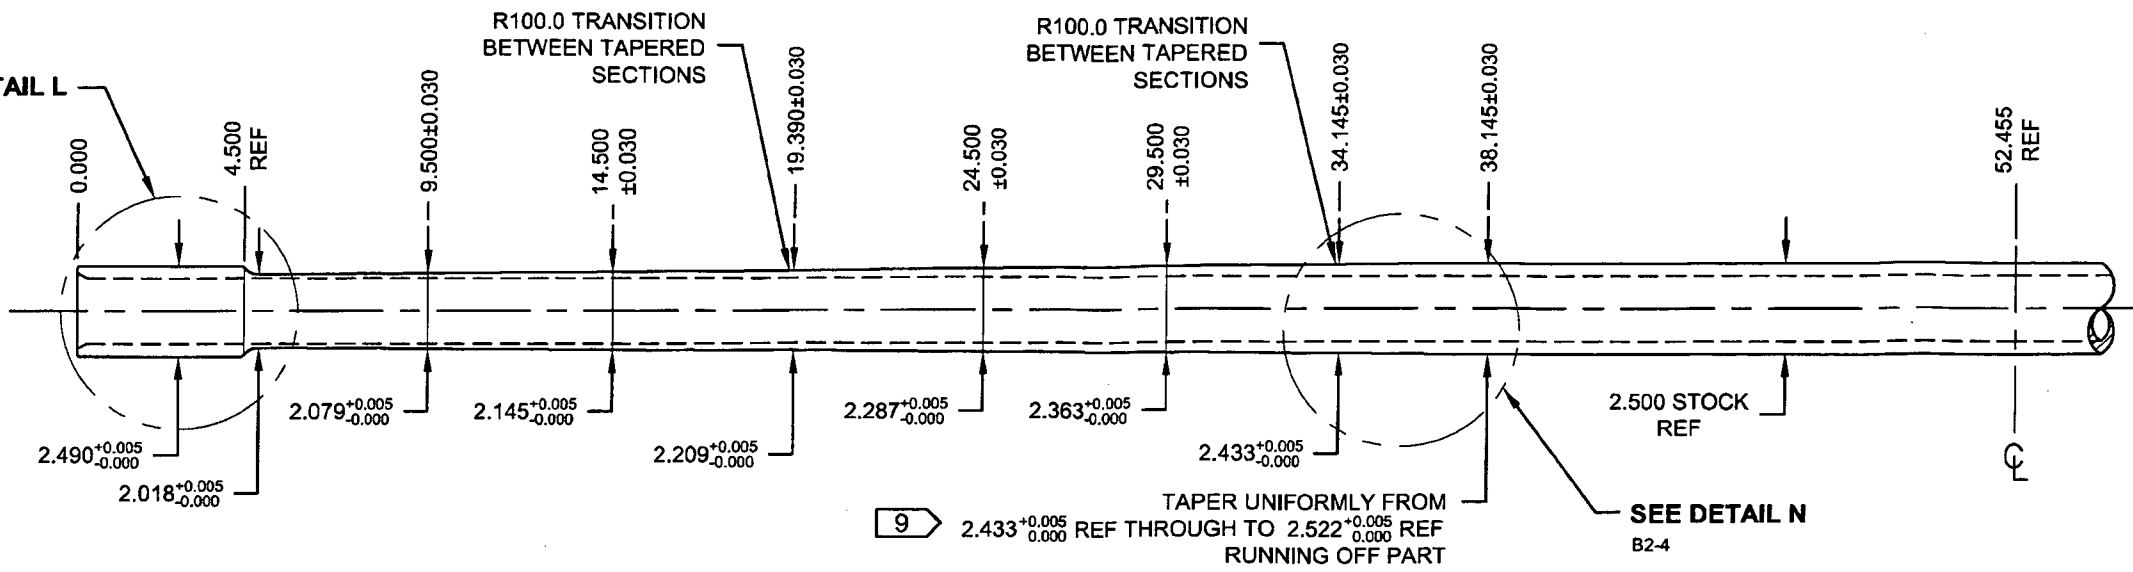


TURNING DETAIL

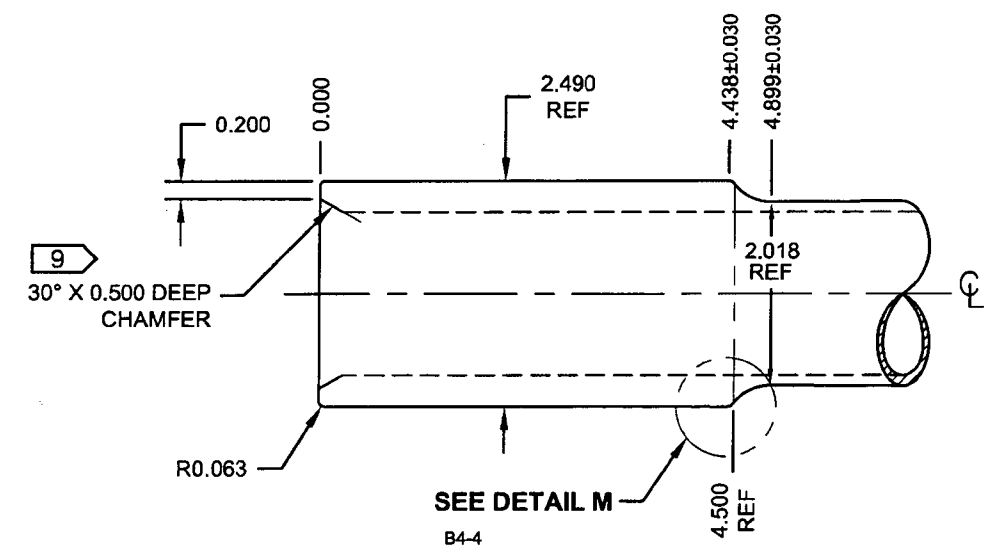

DETAIL L: CROSSTUBE CUFF
NOT TO SCALE

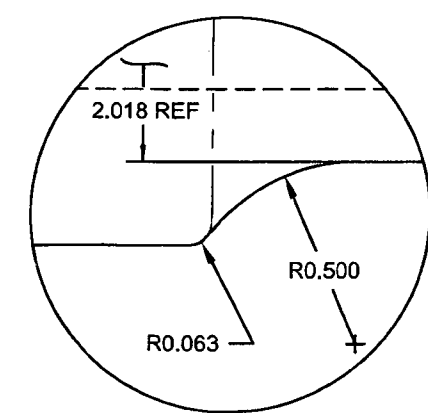

DETAIL M: CUFF TRANSITION
NOT TO SCALE

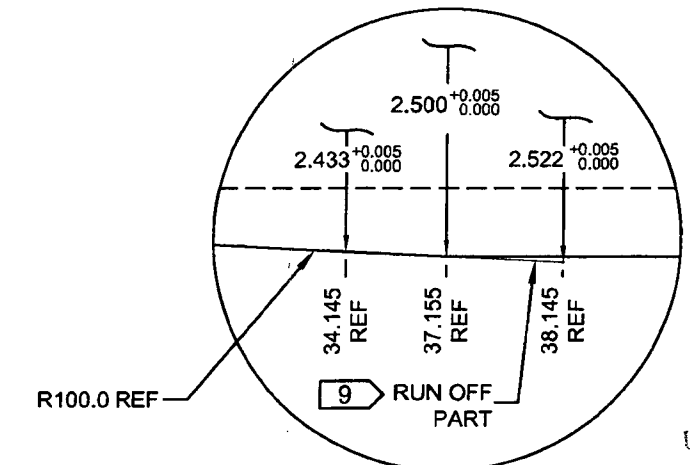

DETAIL N: TAPER RUN-OFF
NOT TO SCALE

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 4353U

RELEASED
08/11/12

DESIGN	9	DART AEROSPACE LTD	
DRAWN	RE	HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. C
MFG. APPR.		D206-667-243	SHEET 4 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (206L HIGH AFT)	NTS
DATE	08.11.06	COPYRIGHT © 2000 BY DART AEROSPACE LTD <small>THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.</small>	

